


**FESTO**

Festo AG &amp; Co. KG

Postfach  
73726 Esslingen  
Deutschland  
+49 711 347-0  
[www.festo.com](http://www.festo.com)

## Justierbausatz EADC-E11-30

### 1. Teileliste

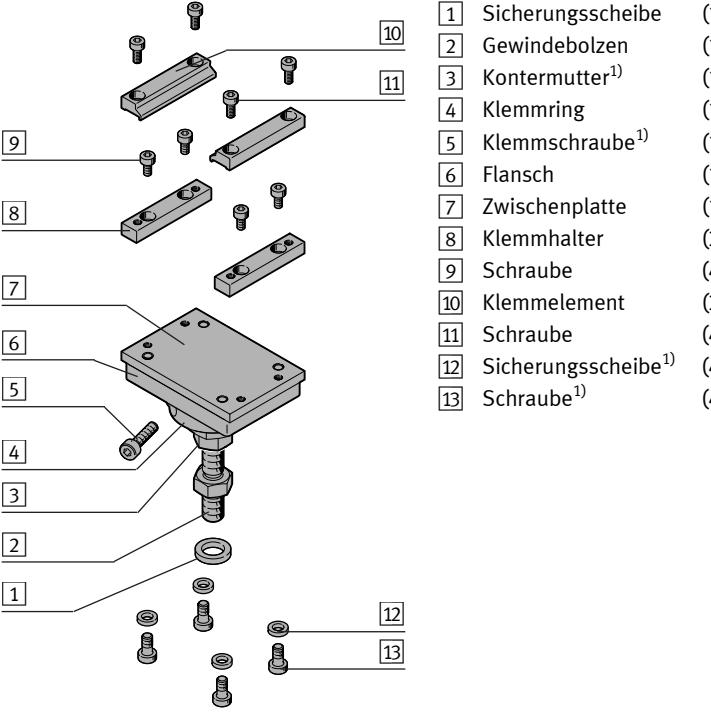

Nicht im Lieferumfang:  
[14] Flächenportal  
EXCM-30

### 2. Bestimmungsgemäße Verwendung

Justierbausatz EADC-E11-30:

Befestigung und Ausrichtung des Flächenportals [14]. Ausgleichung eines Höhenunterschiedes von bis zu 14 mm.

### 3. Sicherheitshinweise und Hinweise zur Montage

- Stromversorgung vor Montagearbeiten abschalten.
- Sicherheitshinweise beachten (→ Mitgeltende Dokumente).
- Anziehdrehmomente einhalten (→ Abschnitt 8).

### i Info


#### Mitgeltende Dokumente

Beschreibung des Flächenportals [14] → [www.festo.com/sp](http://www.festo.com/sp)Abmessungen → [www.festo.com/catalogue](http://www.festo.com/catalogue)

### 4. Vorbereitung


- Notwendige Anzahl der Justierbausätze und die Befestigungspunkte für das Flächenportal [14] beachten (→ Mitgeltende Dokumente).
- Montagefläche mit Befestigungsgewinde für die Gewindestifte [2] vorbereiten. Gewindetiefe  $\geq 12$  mm vorsehen.

### 5. Vormontage

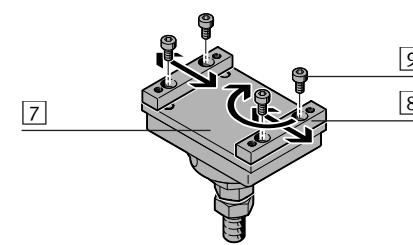


- Klemmhalter [8] auf Zwischenplatte [7] mit Schrauben [9] leicht fixieren.  
→ Die Klemmhalter [8] lassen sich noch bewegen.


### 6. Montage

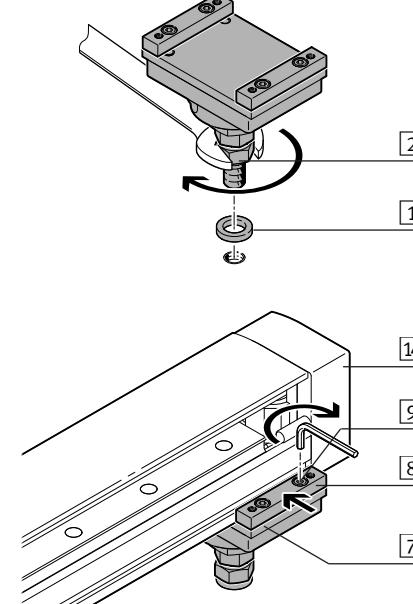

- Justierbausätze mit dem Gewindestift [2] und der Sicherungsscheibe [1] auf der Montagefläche befestigen.
- Justierbausätze in der Höhe entsprechend zueinander vorjustieren (Höhen-differenz  $\pm 1$  mm) (→ Abschnitt 7).
- Flächenportal [14] auf den Zwischenplatten [7] platzieren und ausrichten (→ Mitgeltende Dokumente und Abschnitt 7).
- Klemmhalter [8] an die Profile schieben.
- Schrauben [9] festdrehen.

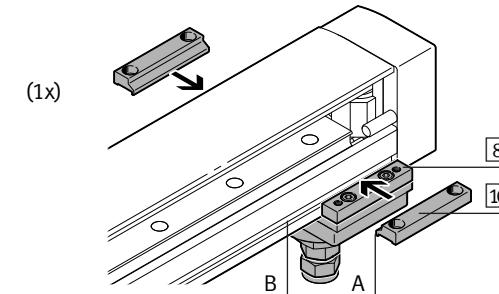

- Klemmelement [10] auf dem Klemmhalter [8] platzieren.
- Nase (A) in die Profilnut (B) schieben.

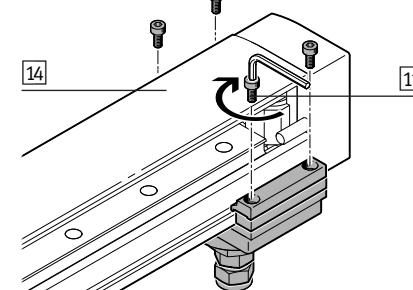


- Schrauben [11] festdrehen.
- Flächenportal [14] ausrichten (→ Mitgeltende Dokumente und Abschnitt 7).

### 7. Justierung


Der Justierbausatz EADC-E11-30 bietet mehrere Justiermöglichkeiten.

- Justierte Ausrichtung mit folgenden Teilen befestigen.

Justiermöglichkeit	Teil
Höhe	[3] Kontermutter
Parallelität	[13] Schraube
Winkel	[5] Klemmschraube

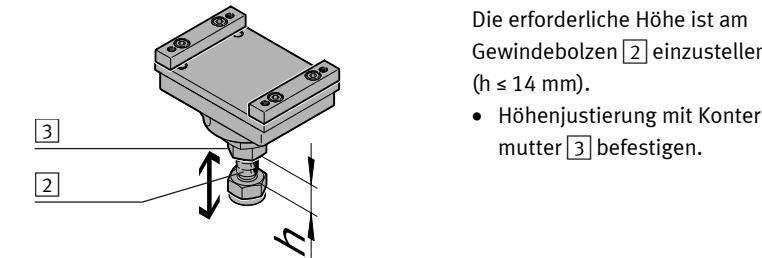

- Die erforderliche Höhe ist am Gewindestift [2] einzustellen ( $h \leq 14$  mm).  
• Höhenjustierung mit Kontermutter [3] befestigen.

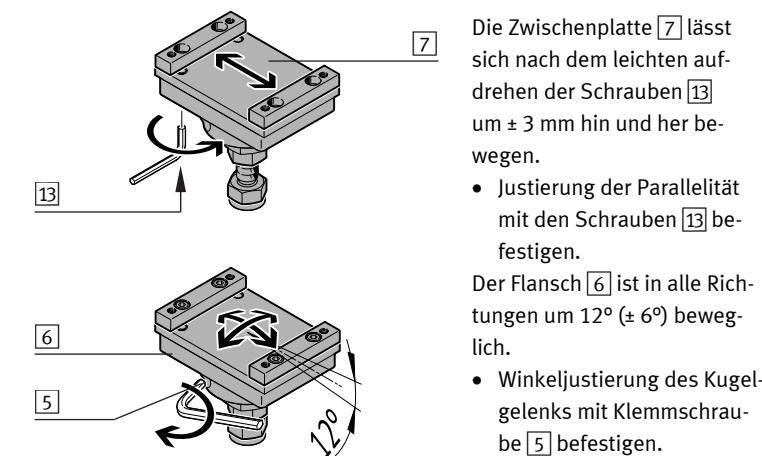

- Die Zwischenplatte [7] lässt sich nach dem leichten Aufdrehen der Schraube [13] um  $\pm 3$  mm hin und her bewegen.  
• Justierung der Parallelität mit den Schrauben [13] befestigen.  
Der Flansch [6] ist in alle Richtungen um  $12^\circ$  ( $\pm 6^\circ$ ) beweglich.  
• Winkeljustierung des Kugelgelenks mit Klemmschraube [5] befestigen.

### 8. Schraubengrößen und Anziehdrehmomente $M_A$ <sup>2)</sup>

EADC-11-	30
[2] Gewindestift	M8 x 11
	[Nm] 25 + 20 %
[3] Kontermutter	M8
	[Nm] 18
[5] Klemmschraube	M4 x 16
	[Nm] 3 + 20 %
[9] Schraube	M3 x 6
	[Nm] 1
[11] Schraube	M3 x 7
	[Nm] 1
[13] Schraube	M4 x 8
	[Nm] 3

<sup>1)</sup> Die Teile [3], [5], [12] und [13] sind lose vormontiert.

<sup>2)</sup> Toleranz für Anziehdrehmomente  $M_A$  ohne Toleranzangabe  $\pm 20\%$


**FESTO**

Festo AG &amp; Co. KG

Postfach  
73726 Esslingen  
Germany  
+49 711 347-0  
[www.festo.com](http://www.festo.com)

## Adjusting kit EADC-E11-30

### 1. Parts list

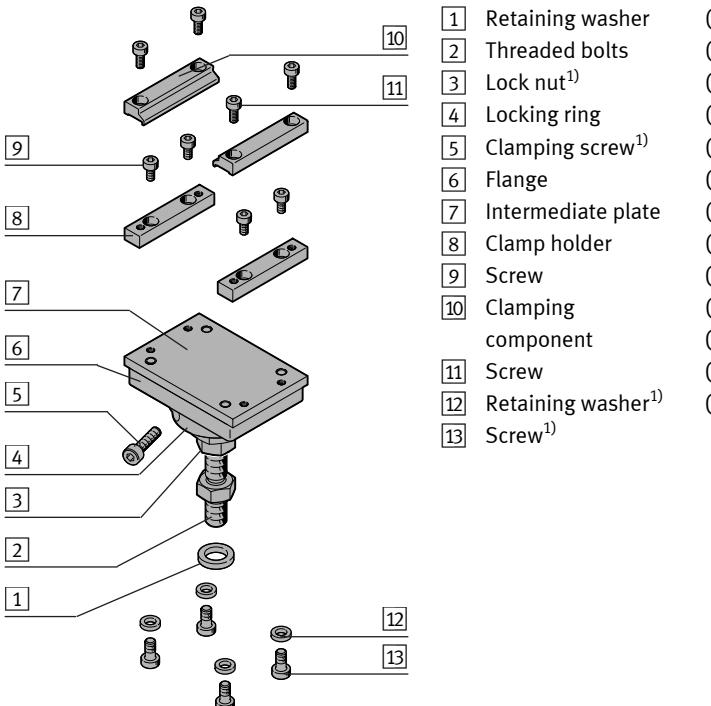

Not included in delivery:  
14 Planar surface  
gantry EXCM-30

### 2. Intended use

Adjusting kit EADC-E11-30:

Attachment and alignment of the planar surface gantry 14.

Compensation of a difference in height of up to 14 mm.

### 3. Safety instructions and notes on mounting

- Switch off power supply before mounting work.
- Observe the safety instructions (→ applicable documents).
- Observe tightening torques (→ section 8).

### i Information copies


#### Applicable documents

Description of the planar surface gantry 14 → [www.festo.com/sp](http://www.festo.com/sp)Dimensions → [www.festo.com/catalogue](http://www.festo.com/catalogue)

### 4. Preparation


- Make sure you have the number of adjusting kits required and observe the mounting points for the planar surface gantry 14 (→ applicable documents).
- Prepare the mounting surface with mounting thread for the threaded bolts 2. Provide for a thread depth of  $\geq 12$  mm.

### 5. Preassembly

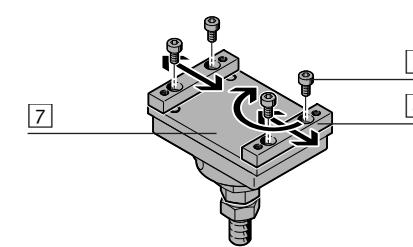


- Clamp the clamp holder 8 lightly to the intermediate plate 7 with screws 9.
- The clamp holder 8 should still be able to move.


### 6. Mounting

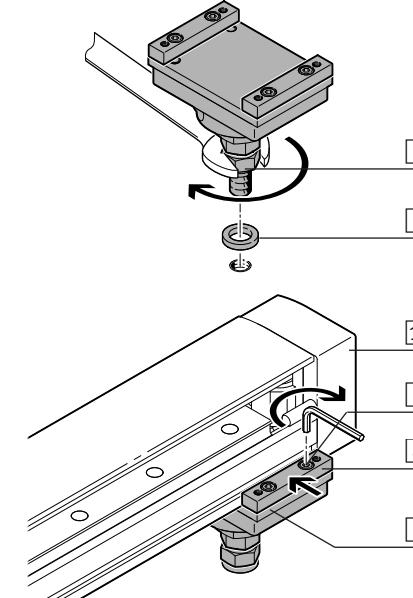

- Attach the adjusting kit to the installation surface with the threaded bolts 2 and the retaining washer 1.
- Pre-adjust the adjusting kits so that their heights correspond (height difference  $\pm 1$  mm) (→ section 7).
- Place the planar surface gantry 14 on the intermediate plate 7 and align (→ applicable documents and section 7).
- Push clamp holder 8 to the profile.
- Tighten screws 9.

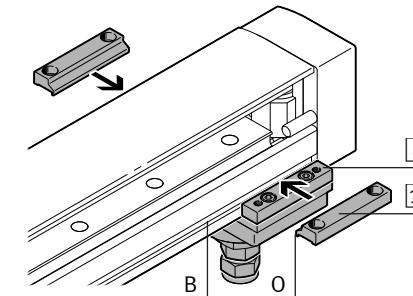

- Place clamping component 10 on the clamp holder 8.
- Push lug (A) into the profile slot (B).

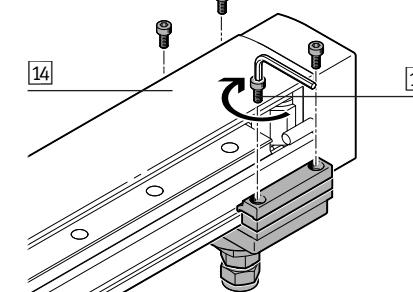


- Tighten screws 11.
- Align the planar surface gantry 14 (→ applicable documents and section 7).

### 7. Adjustment


The adjusting kit EADC-E11-30 offers multiple adjustment options.

- Fix the adjusted alignment with the following parts.

Adjustment option	Part
Height	3 Locking nut
Parallelism	13 Screw
Angle	5 Clamping screw

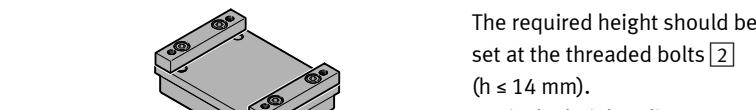The required height should be set at the threaded bolts 2 ( $h \leq 14$  mm).

- Fix the height adjustment with the lock nut 3.

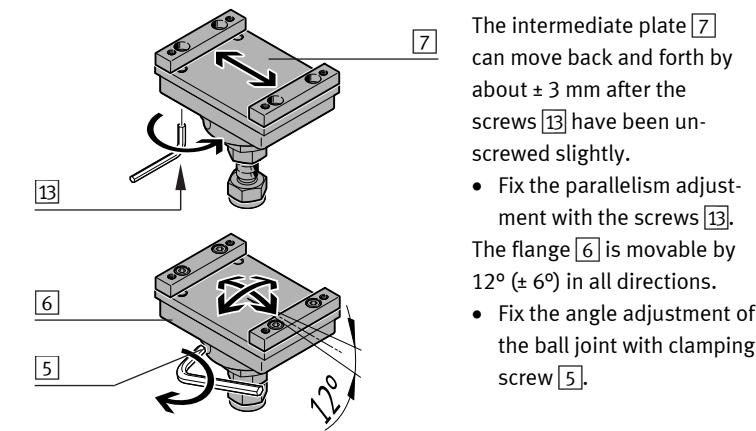The intermediate plate 7 can move back and forth by about  $\pm 3$  mm after the screws 13 have been unscrewed slightly.

- Fix the parallelism adjustment with the screws 13. The flange 6 is movable by  $12^\circ$  ( $\pm 6^\circ$ ) in all directions.
- Fix the angle adjustment of the ball joint with clamping screw 5.

### 8. Screw sizes and tightening torques $M_A^{(2)}$

EADC-11-	30
2 Threaded bolts	M8 x 11 [Nm] 25 + 20 %
3 Locking nut	M8 [Nm] 18
5 Clamping screw	M4 x 16 [Nm] 3 + 20 %
9 Screw	M3 x 6 [Nm] 1
11 Screw	M3 x 7 [Nm] 1
13 Screw	M4 x 8 [Nm] 3

<sup>1)</sup> The parts 3, 5, 12 and 13 are supplied pre-assembled.<sup>2)</sup> Tolerance for tightening torques  $M_A$  without indication of tolerance  $\pm 20\%$